CAD-CUT® PREMIUM PLUS

MEDIUM Care and the formation of the second second



150°C 5 sec

POLYURETHANE, THIN, STRETCHABLE, ELASTIC FLEX MATERIAL WITH A SLIGHTLY ADHESIVE CARRIER.

Premium Plus has a satin finish, and is recommended for easy cutting and weeding. It is suitable for several print proofs. This innovative film is designed for superior stretch on performance fabrics, and most heat sensitive textiles. Due to its durability it performs very well when it is applied to a huge range of fabrics at low temperatures, with a very short application time. It has a pressure sensitive carrier which enables easy cutting and weeding. It is ideal for detailed work and designs featuring multiple colors. The material has a soft matte finish and is available in a huge color selection. Premium Plus is the obvious choice for sports/performance wear and fashion items.



AVAILABLE IN

- 30 cm x 25 m rolls*
- 50 cm x 25 m rolls
- 100 cm x 25 m rolls

* Minimum order quantity: 3 rolls plus 15 € cutting costs

RECOMMENDED FABRICS

- 100% Cotton
- 100% Polyester*
- 100% Nylon**
- Polyester-Cotton blends*
- Lycra[®] / Spandex blends*
- Satin*
- Polyester mesh*
- * Test before application!

CUTTING NOTES

You should always test cut prior to any production run. Remember cutter settings will need to be adjusted as the blade ages. For optimal cutting and weeding, maintain a line thickness of at least 1.5 mm for lettering and logos.

APPLICATION INSTRUCTIONS


- Temperature: 130° C / 150° C
- Time: 10 sec. / 5 sec.
- Pressure: Medium (#4-6 on Hotronix®)
- Peel: Hot
- **Nylon peel: Cold

MULTI-COLOR DESIGNS

Apply background for 3-5 seconds, peel carrier cold. Repeat for additional colors. Finish with final application of 13-25 seconds. Peel cold.

ACCESSORIES RECOMMENDED

- Grip Cover Sheet
- Cover Sheet Non-Sticky
- EZ Weeder[®], LED Weeder. LED Pin or Tweezers

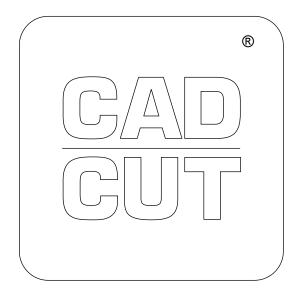

CARE INSTRUCTIONS

Machine wash up to 60° C using mild detergent. Do not use bleach. Do not dry clean. Can be directly ironed.

STORAGE

Store in cool, dry area. Avoid direct heat, sunlight and humidity.

DETAILS









CAD-CUT® PREMIUM PLUS



